
Cancel temporary home / return to last home

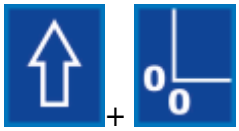

Cancelling the temporary home.

When using this key combination the X and Y coordinate fields in the virtual pendent will no longer show the 0.00 mm coordinate.
Instead you will see the coordinates count between the machine origin and the spindle position above the engraving table.

Returning to Machine Home. Press the SHIFT and then the SET HOME hot keys.

Then push to make the spindle return to the machine home.

Return to last home after machine reboot.

When using this key combination the X and Y coordinate fields in the virtual pendent will no longer show the 0.00 mm coordinate.
Instead you will see the coordinates count between the machine origin and the spindle position above the engraving table.

Returning to Machine Home. Press the SHIFT and then the SET HOME hot keys.

Then push to make the spindle return to the machine home.

Return to the keypad overview.
Continue to the table of contents.

From:
https://manuals.cyborg-engravers.com/ - **cyborg-engravers**

Permanent link:
https://manuals.cyborg-engravers.com/doku.php?id=en:x300:shift_set_home_key&rev=1664103516

Last update: **2022/09/25 12:58**